

**Sayı** : 38591462-410.01-2022-3319

21.10.2022

Konu : Türk Bayraklı Gemilerin Tutulmalarının Engellenmesi.

Sirküler No: 755


Sayın Üyemiz,

Ulaştırma ve Altyapı Bakanlığı, Denizcilik Genel Müdürlüğü'nden alınan ve ekte sunulan 20.10.2022 tarihli ve 718311 sayılı yazıda Uluslararası sefer yapan Türk Bayraklı gemilerin, bölgesel liman devleti kontrolü memorandumlarından en prestijlisi olan Paris MoU'da denetim/tutulma performansına göre 2006 yılı itibarı ile Gri Liste'de, 2008 yılı itibarı ile ise Beyaz Liste'de yer almakta olduğu; 2021 yılında söz konusu listenin 8 inci sırasına yükselerek günümüze kadar olan en üst performansına ulaştığı belirtilerek Paris MoU'da 2022 yılında ise 20.10.2022 itibarıyla 4 (dört)'ü İtalya limanlarında olmak üzere yedi (7) gemimizin tutulduğu ve söz konusu durumun Türk bayrağının Paris MoU'daki konumunun muhafaza edilmesi hususunu tehlikeye düşürdüğü ifade edilmektedir.

Yazıda devamla, 2022 yılında İtalya Limanlarında Türk Bayraklı gemilere gerçekleştirilen denetim kayıtları incelendiğinde, yapılan 32 denetimde 4 gemimizin eksiklikleri nedeniyle tutulduğu, bu denetimlerde toplam 146 eksiklik tespit edilerek bir çoğunun ISM ile ilişkilendirildiği ve ISM'in uygun şekilde işletilmediğinin kayıt altına alınarak 15150 kodu kullanılan gemiler ile tutulan gemilerin 3 ay sonra tekrar denetim aralığına girmekte olduğu bildirilmektedir. Yine; kirlilik şüphesi, personel/üçüncü taraf şikayeti, bir önceki liman tarafından yapılacak ihbarlar vb. durumlar neticesinde gemilerin, periyodik denetim aralığından bağımsız olarak öncelikli denetime tabi tutulabildiği, bu durumun da gemilerimizin Paris MoU kapsamındaki limanlara yapacakları tüm seferlerde PSC denetimine hazırlıklı olmalarını gerektirdiği açıklanarak İdare tarafından yapılan önsörvey aralıklarının gemi/işletici kuruluş performanslarının da dikkate alınması suretiyle yeniden düzenlendiği belirtilmektedir. İtalya limanlarında tespit edilen eksikliklerin (yazıları ekinde liste) analiz edildiğinde, söz konusu denetimlerin çok ayrıntılı olarak gerçekleştirildiği, bazı denetim sürelerinin 8-12 saat aralığında olduğu, balast tankları da dahil olmak üzere tüm alanların kontrol edildiği, operasyonel kontrollerin tümünün yapıldığı, sertifika/manueller ile ilgili tüm gerekliliklerinin kontrol edildiğinin görüldüğü ve bu çerçevede, özellikle İtalya limanlarına sefer yapacak gemilerin ve diğer Paris MoU limanlarına sefer yapacak gemilerle ilgili olarak;

- Gemi donatanları/işletenleri tarafından gerekli tüm önlemlerin alınması, gemilerin denetimlere tamamıyla hazırlıklı olmalarının sağlanması,
- Paris MoU'da denetim aralığında olan gemilerin, mümkünse tüm limanlarda olmak üzere, İtalya limanlarına yapacakları uğraklarda DPA, Enspektörler tarafından eşlik edilmesinin sağlanması,
- Paris MoU'da denetim aralığında olan gemilerin yetkilendirilmiş klas kuruluşları tarafından da takip edilmesi, gerekli olduğu durumda PSC'ye hazırlıklı olmalarını teminen ek denetimlerin gerçekleştirilmesi,
- İtalya limanlarında yapılan denetimlerde Türk Bayraklı gemilerde tespit edilmiş olan ekli listede yer alan eksikliklerin analizinin yapılarak işletilen filoda gerekli düzeltici önleyici faaliyetlerin yerine getirilmesi,
- Limanlarımızda gerçekleştirilen ön sörveylerin, bahse konu hususları da içerecek şekilde ayrıntılı olarak yerine getirilmesi,

Bu belge, 5070 sayılı Elektronik İmza Kanuna göre Güvenli Elektronik İmza ile İmzalanmıştır.

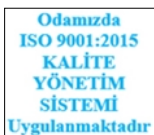

Evrakı Doğrulamak İçin : <https://ebys.denizticaretodasi.org.tr/enVision/Dogrula/BSUNRLYZ4>
 Bilgi için: Mustafa YAVUZYLMAZ Telefon: 02122520130/156 E-Posta: mustafa.yavuzyilmaz@denizticaretodasi.org.tr
 Meclis-i Mebusan Caddesi No:22 34427 Fındıklı-Beyoğlu-İSTANBUL/TÜRKİYE
 Tel : +90 (212) 252 01 30 (Pbx) Faks: +90 (212) 293 79 35
 Web: www.denizticaretodasi.org.tr E-mail: iletisim@denizticaretodasi.org.tr KEP: imeakdto@hs01.kep.tr



- Gerek önceki Paris MoU denetimlerinde gerekse ön sürvey denetimlerinde kayıt altına alınmış eksikliklerin uygun şekilde giderilmiş olduğunun kontrolü,

- Gemi/işletici kuruluş tarafından tespit edilen uygun şekilde çalışmayan/arızalı ekipmanlar ile ilgili olarak ISM kapsamında uygunsuzluk formlarının oluşturulması ve gerekli düzeltici faaliyetlerin yerine getirilmesi ve İdareye, klas kuruluşuna ve liman otoritesine bilgi verilmesi, aksi halde söz konusu eksikliklerin liman denetim uzmanları tarafından tespit edilmesi halinde geminin tutulmasına sebebiyet verebileceğinin bilinmesi,

-Paris MoU limanlarına uğrak yapılacağı durumlarda "psc@uab.gov.tr" ile "gemi.denetim@uab.gov.tr" elektronik posta adreslerine bilgi verilmesi ve PSC denetimleri süresince <https://denizcilik.uab.gov.tr/gemi-denetim-modulu> bağlantısında iletişim numaraları bulunan ilgili İdare uzmanları ile koordinasyon içerisinde olunması, denetim akabinde denetim raporlarının yine aynı adrese gönderilmesi,

hususlarının önem arz ettiği açıklanarak, bilhassa İtalya limanları olmak üzere Paris MoU kapsamındaki limanlara sefer yapacak gemiler tarafından yukarıda izah edilen hususlara titizlikle uyulması, konunun önemine binaen sektöre duyurulması istenmektedir.

Bilgilerinize arz/rica ederim.

Saygılarımla,

e-imza

İsmet SALİHOĞLU
Genel Sekreter

Ek:Denizcilik Genel Müdürlüğü'nden alınan yazı (9 sayfa)

Dağıtım:


Gereği:

- Tüm Üyeler (WEB sayfası ve e-posta ile)
- İMEAK DTO Şube ve Temsilcilikleri
- Türk Armatörler Birliği
- S.S. Armatörler Taşıma ve İşletme Koop.
- VDAD (Vapur Donatanları ve Acenteleri Derneği)
- TÜRKLİM (Türkiye Liman İşletmecileri Derneği)
- KOSDER (Koster Armatörleri ve İşletmecileri Derneği)
- GBD Gemi Brokerleri Derneği
- ROFED (Kabotaj Hattı Ro-Ro ve Feribot İşletmecileri Derneği)
- UTİKAD (Uluslararası Taşımacılık ve Lojistik Hizmet Üretenleri Derneği)
- TAİS (Türk Armatörleri İşverenler Sendikası)
- Türk Uzakyol Gemi Kaptanları Derneği
- Türk Kılavuz Kaptanlar Derneği
- Gemi Acenteleri
- Gemi Sahibi Firmalar

Bilgi:

- Yönetim Kurulu Başkan ve Üyeleri
- İMEAK DTO Şube YK Başkanları
- İMEAK DTO Meslek Komite Başkanları

Bu belge, 5070 sayılı Elektronik İmza Kanuna göre Güvenli Elektronik İmza ile İmzalanmıştır.

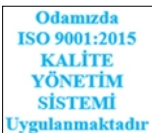

Evrakı Doğrulamak İçin : <https://eys.denizticaretodasi.org.tr/enVision/Dogrula/BSUNRLYZ4>
Bilgi için: Mustafa YAVUZYILMAZ Telefon: 02122520130/156 E-Posta: mustafa.yavuzyilmaz@denizticaretodasi.org.tr
Meclis-i Mebusan Caddesi No:22 34427 Fındıklı-Beyoğlu-İSTANBUL/TÜRKİYE
Tel : +90 (212) 252 01 30 (Pbx) Faks: +90 (212) 293 79 35
Web: www.denizticaretodasi.org.tr E-mail: iletisim@denizticaretodasi.org.tr KEP: imeakdto@hs01.kep.tr





İSTANBUL VE MARMARA, EGE, AKDENİZ, KARADENİZ BÖLGELERİ


ISTANBUL & MARMARA, AEGEAN, MEDITERRANEAN, BLACKSEA REGIONS

DENİZ TİCARET ODASI



CHAMBER OF SHIPPING

Bu belge, 5070 sayılı Elektronik İmza Kanuna göre Güvenli Elektronik İmza ile İmzalanmıştır.

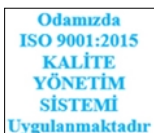

Evrakı Doğrulamak İçin : <https://ebys.denizticaretodasi.org.tr/enVision/Dogrula/BSUNRLYZ4>
Bilgi için: Mustafa YAVUZYILMAZ **Telefon:** 02122520130/156 **E-Posta:** mustafa.yavuzyilmaz@denizticaretodasi.org.tr
Meclis-i Mebusan Caddesi No:22 34427 Fındıklı-Beyoğlu-İSTANBUL/TÜRKİYE
Tel : +90 (212) 252 01 30 (Pbx) **Faks:** +90 (212) 293 79 35
Web: www.denizticaretodasi.org.tr **E-mail:** iletisim@denizticaretodasi.org.tr **KEP:** imeakdto@hs01.kep.tr





T.C.
ULA TIRMA VE ALTYAPI BAKANLI I
Denizcilik Genel Müdürlü ü

Sayı : E-80368960-105.02.01-718311

20.10.2022

Konu : Türk Bayraklı Gemilerin Tutulmalarının
Engellenmesi.

DAĞITIM YERLERİNE

Uluslararası sefer yapan Türk Bayraklı gemiler, bölgesel liman devleti kontrolü memorandumlarından en prestijlisi olan Paris MoU'da denetim/tutulma performansına göre 2006 yılı itibarı ile Gri Liste'de, 2008 yılı itibarı ile ise Beyaz Liste'de yer almakta olup 2021 yılında söz konusu listenin 8 inci sırasına yükselerek günümüze kadar olan en üst performansına ulaşmıştır.

Paris MoU'da 2022 yılında ise yazımız tarihi itibarıyla 4 (dört)'ü İtalya limanlarında olmak üzere yedi (7) gemimiz tutulmuş olup söz konusu durum Türk bayrağının Paris MoU'daki konumunun muhafaza edilmesi hususunu tehlikeye düşürmüştür.

2022 yılında İtalya Limanlarında Türk Bayraklı gemilere gerçekleştirilen denetim kayıtları incelendiğinde, yapılan 32 denetimde 4 gemimizin eksiklikleri nedeniyle tutulduğu, bu denetimlerde toplam 146 eksiklik tespit edilerek bir çoğunun ISM ile ilişkilendirildiği anlaşılmaktadır. ISM'in uygun şekilde işletilmediğinin kayıt altına alınarak 15150 kodu kullanılan gemiler ile tutulan gemiler 3 ay sonra tekrar denetim aralığına girmektedir. Yine; kirlilik şüphesi, personel/üçüncü taraf şikayeti, bir önceki liman tarafından yapılacak ihbarlar vb. durumlar neticesinde gemiler, periyodik denetim aralığından bağımsız olarak öncelikli denetime tabi tutulabilmekte, bu durum da gemilerimizin Paris MoU kapsamındaki limanlara yapacakları tüm seferlerde PSC denetimine hazırlıklı olmalarını gerektirmektedir.

Bu kapsamda İdaremizce yapılan önsörvey aralıkları gemi/işletici kuruluş performanslarının da dikkate alınması suretiyle yeniden düzenlenmiştir.

İtalya limanlarında tespit edilen eksiklikler (ekli liste) analiz edildiğinde, söz konusu denetimlerin çok ayrıntılı olarak gerçekleştirildiği, bazı denetim sürelerinin 8-12 saat aralığında olduğu, balast tankları da dahil olmak üzere tüm alanların kontrol edildiği, operasyonel kontrollerin tümünün yapıldığı, sertifika/manueller ile ilgili tüm gerekliliklerinin kontrol edildiği görülmektedir.

Bu çerçevede, özellikle İtalya limanlarına sefer yapacak gemiler ve diğer Paris MoU limanlarına sefer yapacak gemilerle ilgili olarak;

- Gemi donatanları/işletenleri tarafından gerekli tüm önlemlerin alınması, gemilerin denetimlere tamamiyle hazırlıklı olmalarının sağlanması,
- Paris MoU'da denetim aralığında olan gemilerin, mümkünse tüm limanlarda olmak üzere, İtalya limanlarına yapacakları uğraklarda DPA, Enspektörler tarafından eşlik edilmesinin sağlanması,
- Paris MoU'da denetim aralığında olan gemilerin yetkilendirilmiş klas kuruluşları tarafından da takip edilmesi, gerekli olduğu durumda PSC'ye hazırlıklı olmalarını teminen ek denetimlerin gerçekleştirilmesi,

Bu belge, güvenli elektronik imza ile imzalanmıştır.

Do rulama Kodu: A6DF5F15-6D92-478B-82A1-CDB4E06F1575

Do rulama Adresi: <https://www.turkiye.gov.tr/uab-ebys>

Hakkı Turaylıç Caddesi No:5 06338 Emek / Çankaya / ANKARA

KEP Adresi : uab@hs01.kep.tr

Bilgi için:Koray KORKMAZ

Denizcilik Sörvey

Mühendisi(Koordinatör)



- ç) İtalya limanlarında yapılan denetimlerde Türk Bayraklı gemilerde tespit edilmiş olan ekli listede yer alan eksikliklerin analizinin yapılarak işletilen filoda gerekli düzeltici önleyici faaliyetlerin yerine getirilmesi,
- d) Limanlarımızda gerçekleştirilen ön sürveylerin, bahse konu hususları da içerecek şekilde ayrıntılı olarak yerine getirilmesi,
- e) Gerek önceki Paris MoU denetimlerinde gerekse ön sürvey denetimlerinde kayıt altına alınmış eksikliklerin uygun şekilde giderilmiş olduğunun kontrolü,
- f) Gemi/işletici kuruluş tarafından tespit edilen uygun şekilde çalışmayan/arızalı ekipmanlar ile ilgili olarak ISM kapsamında uygunsuzluk formlarının oluşturulması ve gerekli düzeltici faaliyetlerin yerine getirilmesi ve İdaremize, klas kuruluşuna ve liman otoritesine bilgi verilmesi, aksi halde söz konusu eksikliklerin liman denetim uzmanları tarafından tespit edilmesi halinde geminin tutulmasına sebebiyet verebileceğinin bilinmesi,
- g) Paris MoU limanlarına uğrak yapılacağı durumlarda "**psc@uab.gov.tr**" ile "**gemi.denetim@uab.gov.tr**" elektronik posta adreslerine bilgi verilmesi ve PSC denetimleri süresince "<https://denizcilik.uab.gov.tr/gemi-denetim-modulu>" bağlantısında iletişim numaraları bulunan ilgili İdare uzmanları ile koordinasyon içerisinde olunması, denetim akabinde denetim raporlarının yine aynı adrese gönderilmesi

hususları önem arz etmektedir.

Bu itibarla, bilhassa İtalya limanları olmak üzere Paris MoU kapsamındaki limanlara sefer yapacak gemiler tarafından yukarıda izah edilen hususlara titizlikle uyulması, konunun önemine binaen sektöre duyuru yapılması husunda bilgilerinizi ve gereğini rica ederim.

Mustafa ÇANKAYA
Bakan a.
Denizcilik Genel Müdürü V.

Ek: İtalya'da Tespit Edilen Eksiklikler Listesi. (1 Sayfa)

Dağıtım:

Bölge Liman Başkanlıklarına
Yetkilendirilmiş Klas Kuruluşlarına
İstanbul ve Marmara, Ege, Akdeniz, Karadeniz
Bölgeleri Deniz Ticaret Odası Başkanlığı (İmeak)na
Türk Armatörler Birliğine

Bu belge, güvenli elektronik imza ile imzalanmıştır.

Do rulama Kodu: A6DF5F15-6D92-478B-82A1-CDB4E06F1575

Do rulama Adresi: <https://www.turkiye.gov.tr/uab-ebys>

Hakkı Turaylıç Caddesi No:5 06338 Emek / Çankaya / ANKARA
KEP Adresi : uab@hs01.kep.tr

Bilgi için:Koray KORKMAZ
Denizcilik Sörvey
Mühendisi(Koordinatör)



İTALYA LİMANLARINDA TÜRK BAYRAKLI GEMİLERDE 2022 YILINDA TESPİT EDİLEN EKSİKLİKLER

(Tutulma maddeleri renkli olarak verilmiştir)

DENETİM TARİHİ	DENETİM LİMANI	NO	REFERENCE	EKSİKLİK
05.01.2022	RAVENNA	1	MLC	3 mooring ropes in bad condition.
		2	ISPS	Missing evidence of security drills carried out in the last 3 months, missing evidence of security exercises carried out since 01/2020
		3	MLC	Shipboard working arrangements table not properly filled.
		4	CIII R37	The muster list doesn't specify substion for key persons.
10.01.2022	TRIESTE	1	CII-2 20.6	Water spray system for Ro-Ro Cargo spaces (Upper deck – section no:6) : no 3 heads clogged.
10.01.2022	VENICE	1	CII-2 R14.2	An oxgen cylinder used during the fire drill is not adequately controlled (Indicator shows low cylinder condition-buzzer activated).
		2	MLC	An insufficient quantity of food was detected in the food storage cells. (not compatible with the number of crew members in relation to the duration of the next voyage Constanta. There is no evidence of an order placed in the port of inspection.
		3	CV	The passage plan drawn up for navigation from Ravenna to Margera (last voyage) reports completely incorrect information.
		4	MARPOL	OWS 15 ppm alarm arrangement no tproperly tested.
		5	MLC	Some Seafarers Employment Agreements (SEA) not as required.
19.01.2022	TRIESTE	1	MLC 4.3	Lathe machine, grinder and drill press: emergency stop device (foot switch) missing.
		2	CV R27	At the time of the inspection NP 47 (Admiralty e-publication-Med pilot vol 4) was not available on board.
27.01.2022	TRIESTE	1	CII-2 R4.4	Plastic bins found in galley for all types of garbages not as required.
24.02.2022	PIOMBINO	1	MLC	The refrigerator room are not clean, there is a lot of ice on tubes.
		2	MLC	Galley, the sink are broken.
		3	CIII R20	During the abondonship drill the port side lifeboat is not ready to use.
01.03.2022	RAVENNA	1	MLC	Medical certificate of 2nd officer found not properly filled (indication "engine" instead of "deck")
		2	MLC	SEA of 3rd eng. And cook found with expiring date 01.03.2022 (employed for determinated period of 4 months). Furthermore found 1) "oiler" with SEA for "electrician" (electrician not compulsory for ship in accordance with MSM) 2) "Engine cadet" with SEA for Oiler.

		3	CII-II	Fire door in provision store (upper deck) found blocked with hook and with incorrect placard, not in accordance with ship's firePlan (indication of "B class hinged fire door" – yellow placard, instead of "A class hinged fire door" – red placard)
21.03.2022	MOLFETTA	1	ISPS	ID card not checked and visitor badge not delivered during access on board.
		2	SOLAS CIII	The batteries used for VHF GMDSS are not equipped with a non-replaceable seal to indicate that it has not been used.
		3	MLC 2006 AII-1	Chf Eng. has a SEA(Employment agreement) with wrong entries. (The rank is A/B, date of contract is from 20.08.2020 to 20.10.2020..)
		4	MLC 2006 AIII-1	Hospital sickbay accommodation is used as storage room for paper box, water and soft drink.
		5	SOLAS CII-2 R14.2	A fire hose on bridge deck found leaking on its connection (Def. recorded also on 24.11.2021 is not rectified as per PSC request)
		6	SOLAS CII-2 R15.2	During the fire drill the fireman didn't use the breathing apparatus correctly and showed poor communication with team leader (Def recorded also on 24.11.2021 is not rectified as per PSC request.)
		7	MLC 2006	One termometer found inoperative for one freezer.
		8	SOLAS CI	Safety Equipment Certificate found on board not in original.
		9	STCW KOD	Ch.Eng has a medical certificate expired on 17.12.2021.
12.04.2022	ORISTANO	1	SOLAS CII-1	RPM Indicator Emergency Generator was found out of order.
		2	MLC	Ship not equipped with sufficient air conditioning (cooling) for seafarers accommodation, cabins and other common spaces.
21.04.2022	AUGUSTA	1	SOLAS II-1 R43	Emergency generator simulated black out failed. ACB not closing (automatic or manual, too) Emergency consumers without power in black out.
02.05.2022	RAVENNA	1	ISPS	Access control to ship not as required. Crew member on duty at gangway didn't checked ID cards of PSCO's at boarding.
		2	CIII	No.4 lifebuoys of 8 didn't found in stowed position in accordance with ship's LSA plan(missing). Furthermore, IMO symbol missing.
		3	MLC	Cleanliness of Engine Room not as require. Found minor leakage of oil from M/E (cyl no 6)
		4	ICLL AN 1	Weather-tight door on Bridge deck found blocked with rope (not with clamping devices or other equivalent means attached to the bulkhead.)
		5	CIII R20	Rescue boat found not hooked to ship's davit.
		6	CIII	Emergency instructions for Rescue Boat operations found not readable (not easily seen under emg lighting condition)
		7	CII-2	Auxiliary engine not as required. Hot water heater's steel cover found deformed (top part).

17.05.2022	SAVONA	1	SOLAS CII-2	Two two-way portable radiotelephone apparatus for each fire party for firefighter's communication missing (during fire drill the crew used the GMDSS VHF apparatus).
		2	SOLAS CIII R20	Rescue boat's engine started after several manouvers.
		3	MARPOL ANI R14	It is not possible to conduct OWS test due to a malfunction of the system.
		4	SOLAS CII-2 R14.1	Emergency escape from forecastle store space found closed by grid fixed with bolt and two nuts.
		5	SOLAS CII-2 R15.1	Fire drill failed (i.e. fire team was unable to communicate with team leader, fire zone was not poperly isolate).
		6	MARPOL AN I R7	In the IOPP supplement certificate missing the indication of the ship's "date of major conversion" (10.12.1998).
		7	SOLAS CIIIR20	Rescue boat, during the lowering at sea level water of the rescue boat, a handrail was broken
		8	MLC 2006	Some soft drink in dry store were found mixed with cleaning materials
		9	SOLAS CIII R20	Containers, brackets, racks, and other similar stowage locations for life-saving equipment are not marked with symbols in accordance with the recommendations of the Organization, indicating the devices stowed in that location including, if more than one device is stowed, indication of the number of devices. (i.e. parachute flares and rockets)
10.07.2022	VENICE	1	LL R14	A wheel of the starboard side of the hatchcover of hold no. 4 has the profile visibly damaged and corroded by rust.
		2	CII-2 R14.1	The pressure indicator of the suction line of the Emergency Fire Pump (installed in the EFP room) is not functional. There is another similar meter installed on the line, functioning.
		3	CII-2 14.1	A nozzle of the paint room fire sprinkler system is partially obstructed. Furthermore, the paint cans positioned on the highest shelf of the shelf obstruct the correct distribution of the water jet.
		4	CII-1 R40	A control panel of the ECR shows a risk alarm of missed / precarious electrical insulation of the equipment.
		5	CIII R13	Freefall pyrotechnic distress signals are incomplete (3 signals and 3 parachute signals are in bridge, in a dedicated container and marked with "free fall pyrotechnics")
		6	CV R12	Deviation difference recorded between the compass and the gyrocompass is not compatible with the deviation data shown in the relevant table.
22.08.2022	RAVENNA	1	MLC	Protective eye solutions missing in paint room and battery room.
		2	ISPS	Access control to ship not as required. At embarkation of PSCO, no ID-check was carried out.
		3	CII-2 R14.1	One head of sprinkler system in paint room (STB side) found obstructed by paint's bins. Not functional for its purpose.
		4	MLC	Cleanliness of E/R not as required. Found minor leakages of oil from ME (cyl no 3-4-5), under termo oil pumps and purifiers MGO.
		5	CII-2 R14.1	Fire door (A-class) of electric store didn't close properly due to handle's problem.

		6	MLC	Detected excessive presence of water under air condition system (in air condition room). Furthermore, found condensate water Collection bucket in Engine Control Room next to High voltage panel. Unsafe.
		7	CIII	Abandonship drill not dully carried out: lack of communication between crew (missing taking SART's EPIRB, rockets and flares). Master instructed to put in place additional briefing and drill before departure.
25.08.2022	RAVENNA	1	CIII R9.2.2	Emg instructions for liferaft (PS) not easily seen under emg lighting conditions (light obstructes from pipeline)
		2	CII R14.1	Two self closing fire doors in E/R didn't close properly. (Purifier room/ME floor exit). Furthermore, one fire door behind ER found blocked by small bolt.
		3	MLC	Cleanlines of Engine Room not as required. Detected minor leakages of oil from M/E (Cyl no1 next to fuel oil leakage alarm, and cyl no 3). Furthermore found minor leakages of oil from filter of FO purifier.)
		4	CVI IBC 19	Shipping documents of loading port (Braile/Romania) reports wrong information about Cargo viscosity at 20 degree C reported "68 instead of "30". Master instructed to put in place briefing with officers in order to improve controls of Shipping documents.
		5	MARPOL	Cargo record book not properly filled: missing indication to discharge rate during discharge in to the sea of tank washing "F" on ...
		6	MLC	Thermometers of freezing for vegetables and fish found out of order.
31.08.2022	TRIESTE	1	MLC	Air Condition plant, filtrs found dirty.
01.09.2022	TRIESTE	1	MLC	Accommodation Air Condition plant, filters missing.
09.09.2022	RAVENNA	1	MLC A4.3	Engine room found severely dirty, found oil leakages everywhere (auxilaiary engines, purifier room, propeller pitch hyroulic pump etc) Especially were found huge oil leakages from fuel oil shock pump/automatic filter, DO seperator & LO seoperator). The Working environment of engine room is absulately substandart.
		2	II-2 R14.2	2 self closing fire doors in accommodation not properly closing.
		3	II-1 R29	Minor oil leakages from Steering gear.
		4	MARPOL	Engineers not familiar with OWS 15 ppm test.
		5	II-1 R43	2 emg lights ST besids Cargo holds found inoperative.
		6	CIII R9	Operating instructions for liferafts PS&Forward not in working language.
		7	CII R14.2	Hydraulic oil pipe broken during test of funnel's dampers: oil spil on B deck.
		8	MLC A4.3	Oil leakages from PS forward winch and hydraulic pump in forecstle.
		9	CIII R20	IMO label missing for one lifebuoy PS midship.
		10	MLC	Missing eyewash solution in paint locker.
		11	CV R27	The last Notice to Mariners found on board was not the last one published by the Admiralty (week 31 found on board) not up to date.

		12	C5 R27	Nautical charts no 220 and 200 not up to date.
		13	C IV R17	In the GMDSS radio log book there is no evidence of the montly test carried out by the crew. Furthermore missing entries for the Daily tests of the 07.09 and 08.09.
		14	MLC A3.1	Common toilet on the fourth floor found dirty and with the toilet flushing device broken. Furthermore the shower was found inoperative and without courtain. The showers of the bosun cabin and of the common toilet of A deck STBs were found withouts curtains. Not hygienic.
		15	MLC A 3.2	No thermometer was found inside the fridge and the freezer of the messroom. It was impossible to determine the temperature.
		16	C III R35	In the SOLAS training manual missing evidence of the procedure for the use of helicopter rescue gear (slings, baskets, stretchers), breeches buoy and shore lifesaving apparatus and ship's line throwing apparatus.
		17	MLC A4.3	Missing protection devices fort he lathe machine & drill press in ER workshop.
		18	MLC A.4.1	During abondon ship drill one crew member didn't wear safety shoes.
		19	STCW	During drill in ER, Engine crew has not a ready familisation with alarm systems.
14.09.2022	BARI	1	C XI-1 R5	Not found on board Form 2-3 of CSR no 4/9 and Form 1 fo CSR no 8/10.
		2	CII-2 R14.2	Some self closing fire doors didn't close properly (B-deck stairways C-deck stairways, cable room)
		3	MLC A3.1	Extractor duct of galley found dirty.
		4	C V R 12	Standart magnetic compass found not clearly readable.
		5	MARPOL	Not all crew was familiarized with garbage management plan.
28.09.2022	RAVENNA	1	CII-2 R14.2	Emergency fire pump not properly working, it started without giving enough pressure to fire line.
		2	CII-2 R14.2	Fire line found holed ST midship.
		3	CIII R 37	Muster list doesn't specify the following duties: closing of the WT doors, fire doors, valves, scuppers, side scuttles, skylights, port holes and other smilar openings in the ship. Furthermore in abondonship duties aren't specified crewmembers in charge of launching liferafts; furthermore aren't specified to ensure that life saving and fire appliances are maintained in good condition and are ready for immediate use, and also substutides for key persons who may become disabled.
		4	CIII R20	Missing evidence of 5 yerly service for lifeboats, furthermore remote control wire broken during lowering of ST Lifeboat.
		5	CIII R19	During abondon ship drill thr crew wasn't properly mustered and showed a lack of communication (the crew went to a first wrong muster station) and a very lack of training on lowering ST lifeboat; the remote conrol wire broken, the lifeboat's wires turned around and blocked the lifeboat lowered, were necessary a lot of attempts to release the wires enough to heave up again the LB.
		6	CV R34	Last voyage plan not berth to berth.
		7	CII R19	During the fire drill the crew showed a lack of training and a lack of communication: the cook remained inside the fire's scenario(galley) not aware of the drill in progress; furthermore the galley wasn't insulated (door kept open), the fireman didn't wearBreathing apparatus and entered the fire's scanario without using a fire hose or fire extinguisher, just holding a torch.

		8	CV R26	Missing evidence of steering gear drills carried out.
		9	CV R 27	Some nautical charts used during last voyage (no 204,220, 1467, 1445) not updated.
		10	MLC A4.3	Oil leakages from aux engines, no 1&2 purifiers, LO purifier, no 1&2 air compressors, FO transfer pump, No 1&2 circulating pumps, No1 FO booster pump. Furthermore bilge wells to be cleaned.
		11	CIII R20	Missing evidence of Solas type approval for 4 lifebuoys, furthermore 3 lifebuoys's lights inoperative, furthermore IMO symbol missing for 1 lifebuoy.
		12	MARPPOL	OWS inoperative, test failed. Furthermore calibration certificate missing.
		13	CII-2 R14.2	Galley's egzhaust duct found greasy and dirty of oil.
		14	CIII R20	Missing lights on lifejackets of 2nd officer, bosun and one AB
		15	CII-1 R26	Boiler found inoperative.
		16	MLC A3.1	All common sanitary facilities and showers found not properly maintanead, very dirty, not hygienic. Furthermore one shower's head missing; furthermore hot water not available on board.
		17	MLC A3.2	Cold rooms to be maintained. Furthermore thermometers missing.
		18	MLC	Missing drying machines or adequately heated and ventilated drying room.
		19	CII-2 R7.2	Missing evidence that fixed fire detection and fire alarm system is of an approved type.
		20	CII-1 R43	Emg DG not properly working. It started without supplying power; furthermore external em'cy lighting close to the bridge inoperative also with main power supply.
		21	MARPOL	NOX technical files for aux engines missing on board.
		22	MARPOL	Garbage record book not properly filled in: several times isn't specified the quantity for each category of garbage delivered ashore; incinerated or food waste disposed at sea.
		23	STCW	Missing Flag State endorsement of GOC IV for Chief Officer.
		24	MARPOL	Oil record book not properly filled. (Records by mistake)
		25	MLC	SEA of donkeyman not properly filled in; the total montly pay doesn't match with the sum of basic wage, fixed overtime, leave pay.
		26	CIII R17.1	Missing ob board Ship Specific Plans for the Recovery of Persons from the Water.
		27	ISPS Kod	Visitor's log book not as required. Is possible to fill only name of the visitor. Date&signature, missing purpose of the visit, n. ID card.
		28	ISPS	Missing records and detailes of additional security measures put in place in the port of Kandia/India on 06-07.09.2022 that was marsec level 2 according to ISPS ship pre-arrival security informaation form.
		29	ISPS	Missing records of maintenance, calibration and testing of security equipment.
		30	CIII R20	Missing weekly records of LSA maintenance since july 2022.
		31	CV R27	ITU list V (List of ship stations) 2021 found on board.
		32	CII-2 R14.1	Missing weekly records FF equipment maintenance since july 2022.
		33	MARPOL	SOPEP, List of authorities or persons to be conducted in the event of an oil pollution incident not updated.
		34	MLC A4.3	Both winches of Crane no 3 found rusty & not properly maitanead.

		35	MLC A4.3	Missing protection devices for drill press, lathe machine&grinder in ER workshop.
		36	CIII	LSA training manual incomplete, missing some instructions (E.G. methods, and use of devices for protection in launching areas, illumination in launching areas, use of drogues, use of engine and accessories, instruction for emg repair of the LSA.)
30.09.2022	POZZALLO	1	MLC A4.3	Rubber mats in front of high-voltage electrical panels non-compliant.
		2	CV R 27	List V – List of Ship Stations and Maritime Mobile Service Identity Assignments 2022 editions not on board.
		3	CV R27	Natical charts Nr. 2124 not up to date.
04.10.2022	RAVENNA	1	CIII R35	LSA training manual incomplete, not properly specified the following instructions; methods and use of devices for protection in launching areas; use of all survival equipment, use of drogues; hazards of exposure and the need for warm clothing; recovery of survival craft and rescue boats including stowage and securing, methods of retrieval, including the use of helicopter rescue gear (slings, baskets, stretchers), breeches buoy and shore life-saving apparatus and ships line throwing apparatus.
		2	CIII R37	Muster list incomplete, not properly specified the following duties: starting fire pumps, launching of liferafts.
		3	CIII R19	During fire drills the crew showed a lack of training and a lack of communication: fire's scenario wasn't understood by all crew members and fireman no 1 was OS 2 instead of AB 2 as required by muster list.
		4	MARPOL	Engineers not familiar with Oil Filtering Equipment.
		5	MLC A4.3	Cleanlines of ER not as required. Oil leakages from both air compressors.
		6	CII-2 R14.2	Some self closing fire doors in accommodation found not properly closing.
		7	CIII R17.1	Plans for the Recovery of Persons from the Water not ship specific.
		8	STCW	Hours of rest for cook and steward are divided into more than two periods.
		9	ISPS	Missing records and details of additional security measures put in place in the port of Odessa/Ukraine on 11-14.09.2022, Taman/Russia on 09-11.08.2022, Nova/Russia on 16-18.07.2022 and Tuapse/Russia on 19-22.06.2022 that were at marsec level 2 according to ISPS ship pre-arrival security information form.
		10	ISPS	Access control to ship not as required: visitor badge wasn't given to PSCO.
		11	ISPS	Security contact list not as required: missing contact details of PFSO of Docs Cereali terminal in Ravenna Port.
		12	MLC	Private sanitary facilities floor of 3rd engineer to be maintained.
		13	MLC	Missing protection devices for drill press&lathe machine in ER workshop.
		14	MLC	Meat cold room to be maintained.